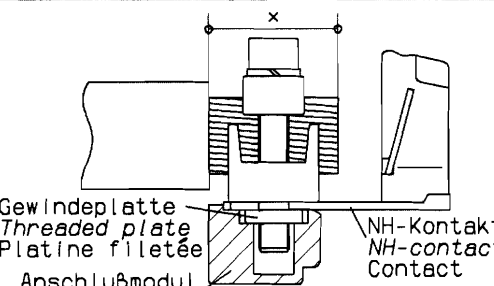
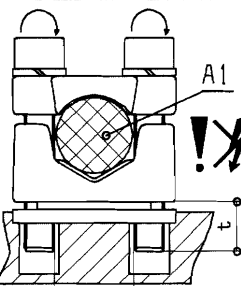
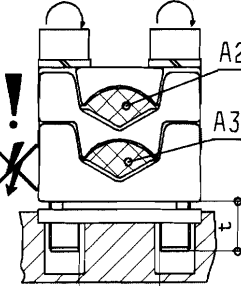
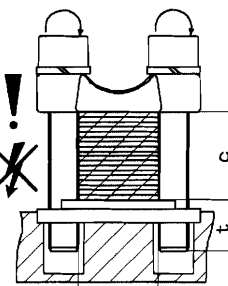


Prismenklemmenmontage - Assembling prism terminals - Montage bornes à prismes

 Gewindeplatte Threaded plate Platine fileté Anschlußmodul Connecting modul Module de raccordement NH-Kontakt NH-contact Contact	 A1	 A2 A3	 A3
Size 1 5 6Nm 53lb. in. x=23mm d=18mm t=6-17mm	A1= 70-150mm²	A2, A3= 35- 70mm² 1)	c=2-14mm
Size 2 6 8Nm 70lb. in. x=27mm d=21mm t=7-21mm	A1=120-240mm²	A2, A3= 70-120mm² 2)	c=0-14mm
Size 3 6 8Nm 70lb. in. x=30mm d=25mm t=8-25mm	A1=150-300mm²	A2, A3=150-185mm²	c=0-13mm

1) 35 und 50 mm² (f) mit Aderendhülse
35 and 50 mm² (f) with endsleeve
35 et 50 mm² (f) avec embout

2) 70, 95 und 120 mm² (f) mit Aderendhülse
70, 95 and 120 mm² (f) with endsleeve
70, 95 et 120 mm² (f) avec embout

Vorbereitung zur Prismenklemmenmontage
Preparation for assembling the prism terminals
Préparation du montage des bornes à prismes

